USB Adapter
For Windows 98/ME/2000/XP

Driver Installation Under Windows 98/ME/2000/XP

1. Step 1: Don't Plug in the USB type A receptacle of the cable to the USB connector of your computer.

    Step 2: Download USB Adapter program from www.vertexdiagnostics.com/software-download

    Step 3: Go to the downloaded file on your computer and click "Run"

    Step 4: The InstallShield Wizard will pop up, when it does click "Next". See Figure 2.
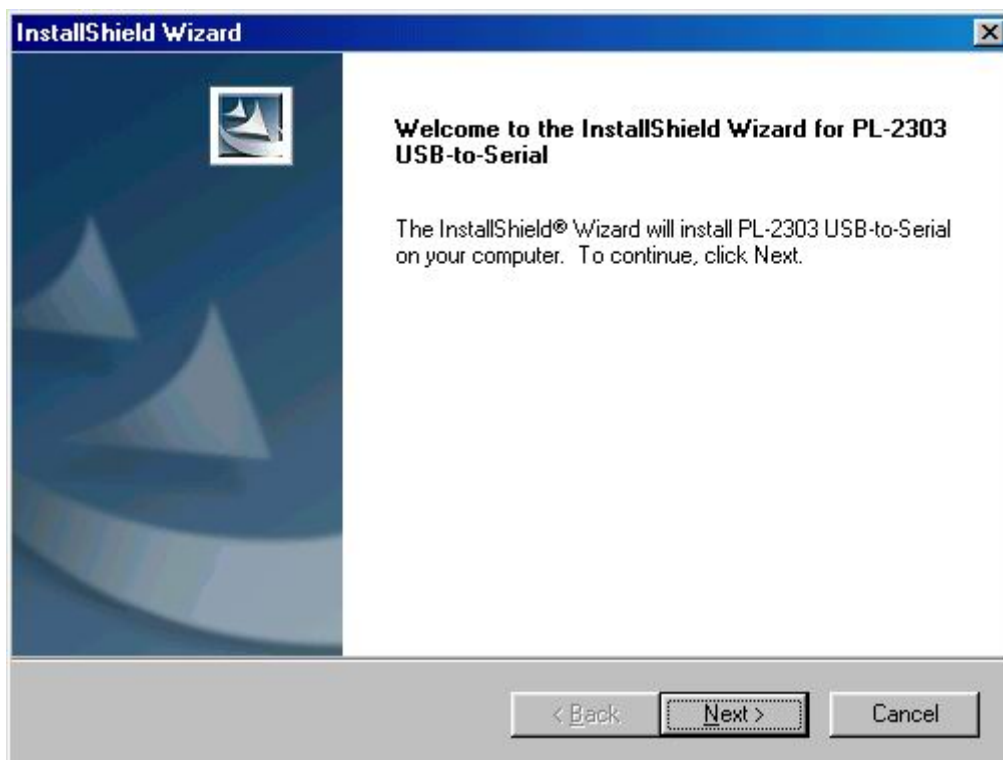

Figure 2

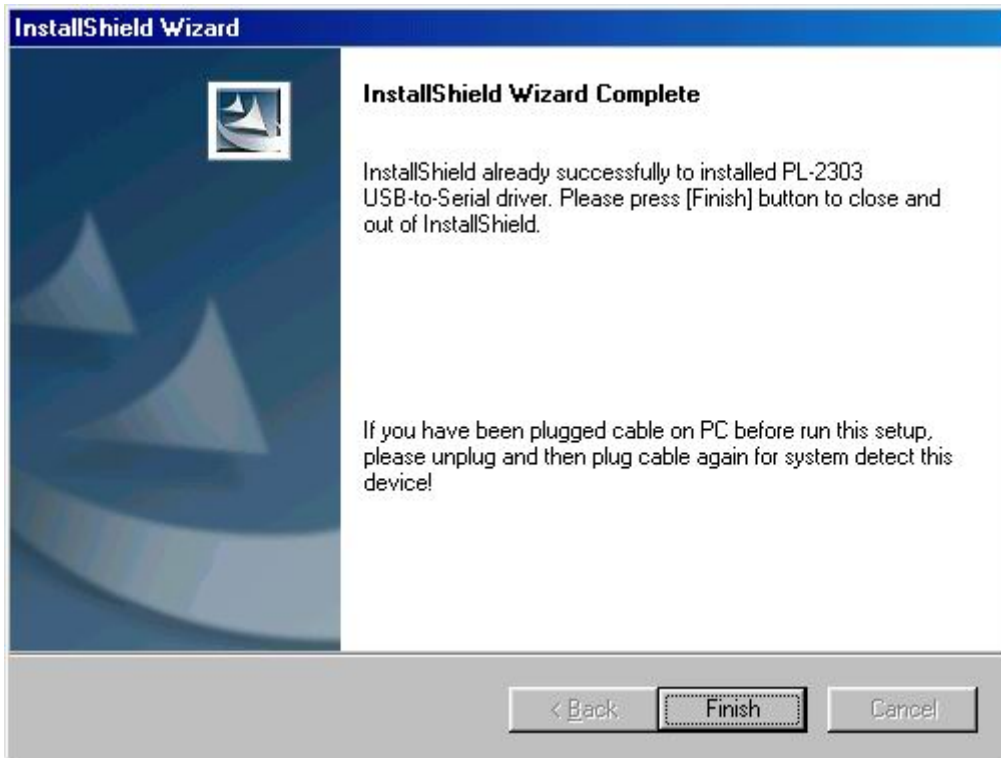3. Windows has finished installing the software, click "Finish" to close the Wizard. See Figure 3.

Figure 3

4. Plug USB/Serial cable into your computer's USB port.

5. Open "Device Manager" under System Properties and check if there is the device you install under "USB to Serial (COM3)". See Figure 4.
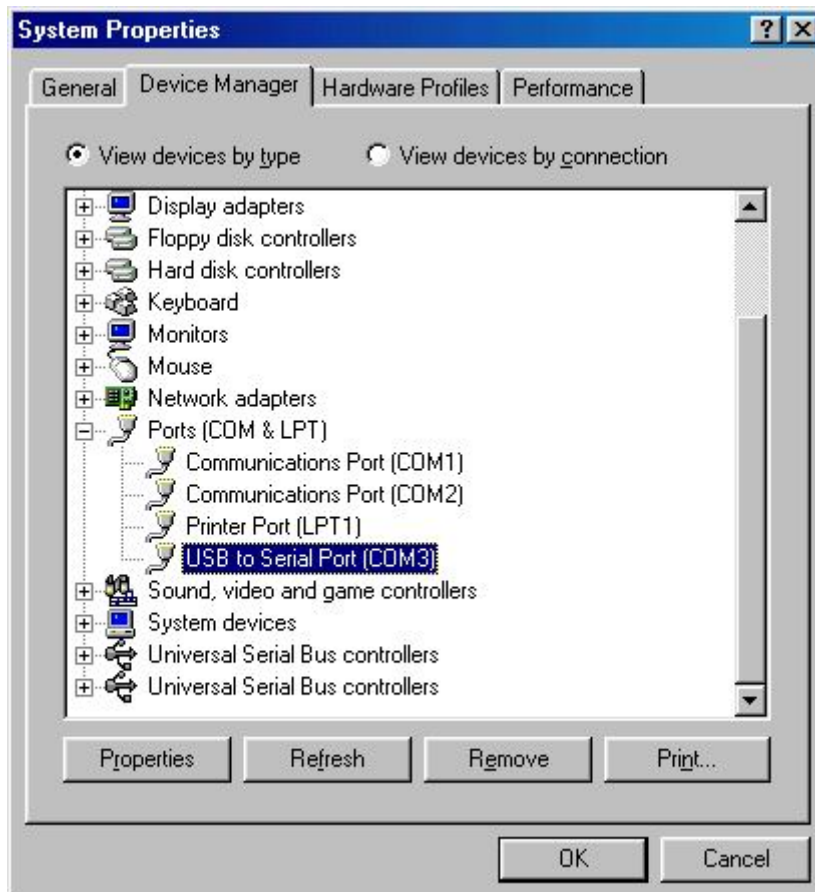

Figure 4